

RS1型旋转开关系列
Rsone Serial Selector Switch
Series



- 特点
- 切换手感好，档位清晰
 - 多种输入和输出可供选择
 - 多种转轴转轴长度可供选择
 - 多种外形尺寸可供选择

Features

- The feel is good, Positions number is clear
- Selection of a variety of input and output
- Selection of a variety of shaft axis length
- A variety of shape size to choose from

- 应用

电风扇 | 榨汁机 | 电烤箱 | 电炖锅 | 电暖浴霸 | 窗机
空调器等家用电器 | 工业用电器及其他类似的电器设备

Application

Electric fan | juicer | electric oven | slow Cooker
water heater | electric heating bath bully | air conditioner
Such as household appliances | industrial appliances and
other electrical equipment



项目 Item		特性值 Value	
绝缘电阻 Insulation resistance		≥100MΩ (500VDC)	
接触电阻 Contact resistance		≤50mΩ (初始值) (Initial value)	
耐压 Test voltage	同极不相接端子间 Between terminals of the same polarity	AC1000V,50/60Hz,1min	
	带电金属零件与地 (外壳) 之间、接线端 与不带电金属件之间 Between current-carrying metal parts and ground(case),and between each terminal and non-current-carrying metal parts.	AC2000V,50/60Hz,1min	
寿命 Life expectancy		机械≥100000次；Mechanical≥100000 cycles	
		电气 Electrical	6A/10(3)A 125/250VAC 3E4(CQC、CB、TUV)
			6A/10A/13A 125/250VAC 1E5(UL)

- 型号规格命名及含义 | Model specs naming and meanings RS1-□□□□□
1 2 3 4 5



1 点动 Crawl	D: 点动 Crawl A: 无点动 No point move	4 螺母 Nut	L: 需配螺母 Need to match the nut N: 无需配螺母 No need to match the nut
2 角度 Angle	A:22.5° B:30° C:45° D:90°		
3 档位数 Number of gears	1:1档 Positions number 1 2:2档 Positions number 2 3:3档 Positions number 3 4:4档 Positions number 4	5 锁螺丝 Lock screw	1: 需锁螺丝 Lock screw 2: 不需锁螺丝 Do not need to lock the screw

- RS1外形尺寸安装图 | Dimensions



RS1-AC2LO2

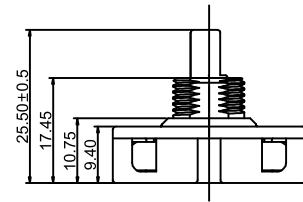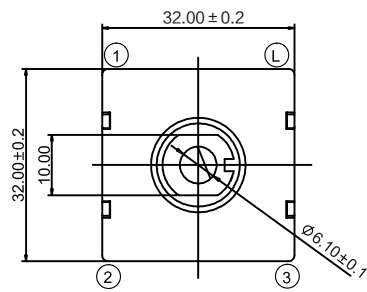



RS1-DC2N1

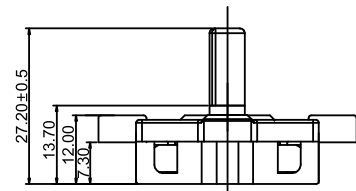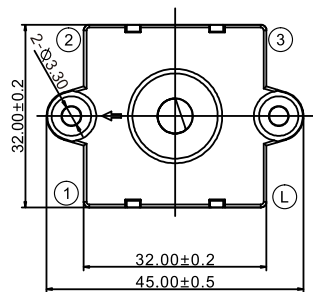



RS1-AA2L2

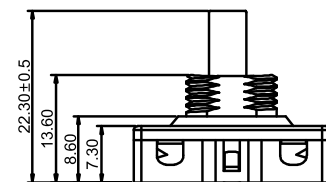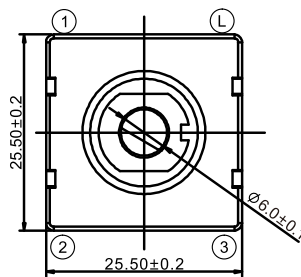



RS1-AA2N1

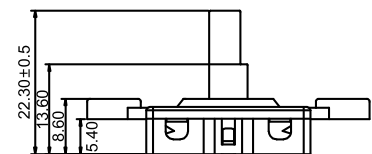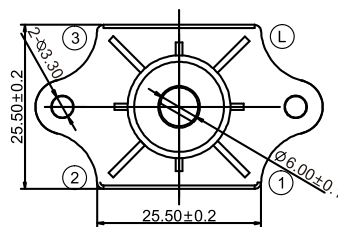

RS1-AC2N1

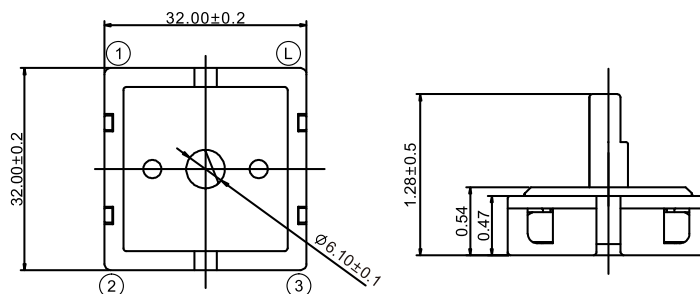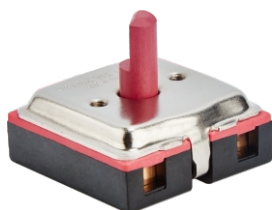

RS1-AC2L2

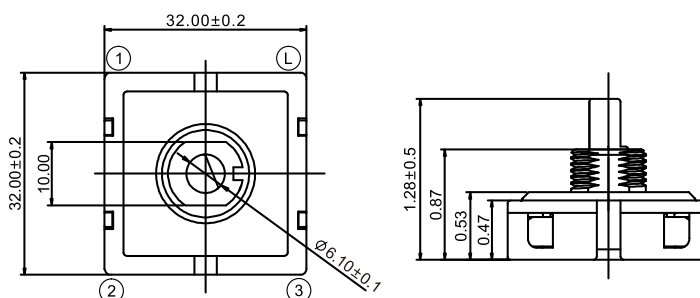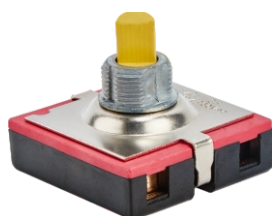

- RS1系列旋转开关部分功能档位切换程序图 | RS1 series rotary switch features gear switch program chart

RS1-DC2L0

档 入	45° 出	P	0	1	2
L	1	⊗			⊗
	2				
	3			⊗	

⊗ 表示线路接通

RS1-DC2L0

档 入	45° 出	P	0	1	2
L	1				
	2	⊗			⊗
	3			⊗	

⊗ 表示线路接通

RS1-AC2L0

档 入	45° 出	0	1	2
L	1			
	2			⊗
	3	⊗		⊗

⊗ 表示线路接通

RS1-AC2L0

档 入	45° 出	0	1	2
L	1	⊗		
	2			
	3			⊗

⊗ 表示线路接通

RS1-AC1L0S

档 入	45° 出	0	1
L	1	⊗	
	2		
	3		

⊗ 表示线路接通

RS1-AC2LS

档 入	45° 出	0	1	2
L	1		⊗	
	2			⊗
	3			

⊗ 表示线路接通

RS1-AC2L0

档 入	45° 出	0	1	2
L	1		⊗	⊗
	2			⊗
	3			

⊗ 表示线路接通

RS1-AC2L0S

档 入	45° 出	0	1	2
L	1	⊗		
	2			⊗
	3	⊗		⊗

⊗ 表示线路接通

RS1-AC2L0

档 入	45° 出	0	1	2
L	1		⊗	
	2		⊗	⊗
	3			⊗

⊗ 表示线路接通

RS1-AC3L0

档 入	45° 出	0	1	2	3
L	1		⊗		
	2			⊗	
	3				⊗

⊗ 表示线路接通

RS1-AA3L0

档 入	22.5° 出	0	1	2	3
L	1		⊗	⊗	
	2			⊗	
	3				⊗

⊗ 表示线路接通

RS1-AA3L0

档 入	22.5° 出	0	1	2	3
L	1		⊗	⊗	
	2		⊗		⊗
	3		⊗	⊗	

⊗ 表示线路接通